



Connection offline

Technical product information

Transmission: clutch pedal clacks

Transaction No.: 2018689/1

Release date: 25-Sep-2008

Customer statement / workshop findings

Noises (clacking) when operating clutch

Technical background

Conflicting tolerance between pressure drawbar mounting and pressure drawbar of clutch master cylinder.


Production change

In preparation.

Measure

Cut 2 pieces of felt (part number: 533 867 910 A).


Length: 16mm

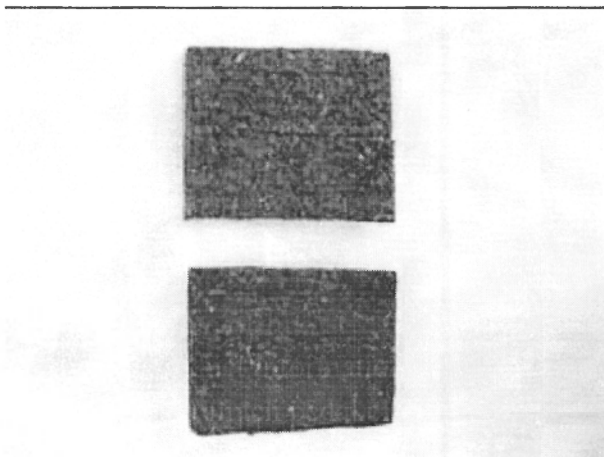

Cut the short side to about half the length (8mm).



Press together the mounting (part number: 1K0 721 357 A).

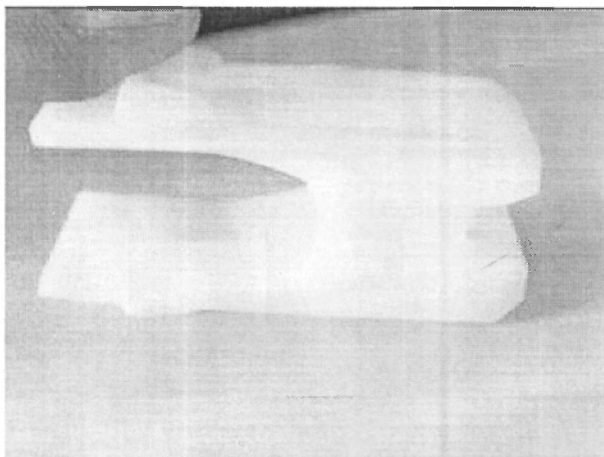

bond the felt at 7mm distance on the pressed-together mounting.

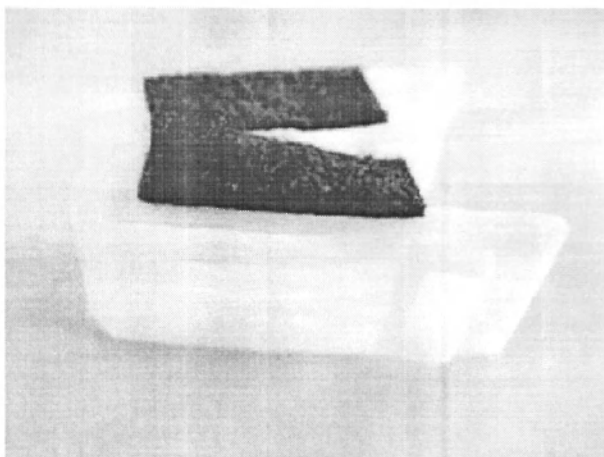


Illustration shows relaxed condition

Replace the treated mounting on the clutch pedal according to the repair manual.

Accounting instructions

Service number. / damage code/ manufacturer: 3005 / 020 /

Accounting with APOS:

Touran IT*

Main operation	68181900	Remove and install storage box under dashboard	40 TU
Associated operation	30055599	Replace clutch pedal mounting	10 TU
	includes	Modify clutch pedal mounting	

Accounting with APOS/2

model	Illustration	Position	Number	Activity	Time units
IT*	721-25	25	721357	55	*